



## RTX-59C-CAD

Dakota Digital RTX Instrument Installation For 1959 Cadillac

Your new RTX-59C-CAD kit includes:

**RTX Display** 






## Installation


1. Remove the stock gauge cluster and clock from the dash and save all hardware for reassembly.



2. Remove and retain the four (4) nuts indicated below to completely remove the OEM bezel.

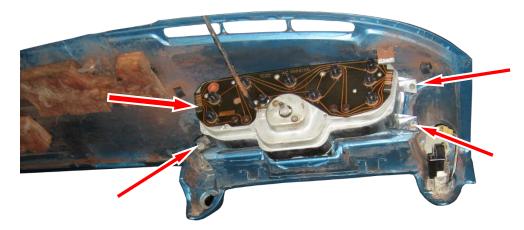

3. Remove the OEM bezel from the stock gauge by removing the eight (8) screws indicated below.

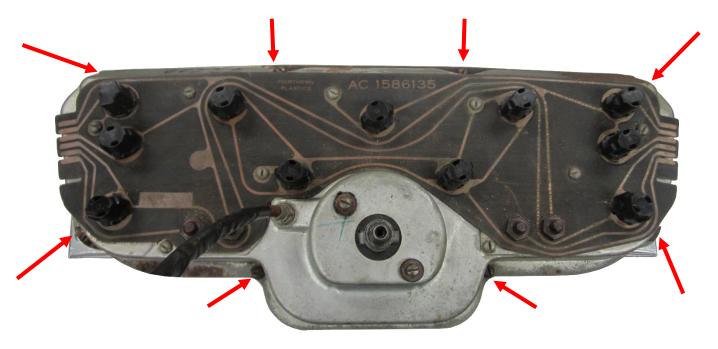

4. Completely strip the bezel of all remaining components, light guides, and indicator panels. If removing the factory gear indication, the provided blackout lens may be used. Peel the protective cover off the Blackout Lens and place it over the gear indicator opening with the shiny side facing out towards the driver and glue it in place using a black RTV silicone or similar to. Let the silicone fully setup and dry before moving on to the next step to prevent damage to the Blackout Lens.



5. Attach the provided clock harness. Remove the two nylon thumb nuts from the clock mounting studs, using them to install the factory clock mounting bracket.




6. Mount the auxiliary gauges to the OEM bezel using the provided #6-32 short screws in the locations below. It is advised to use a magnetic screwdriver to line up the side screws.




7. Mount the main gauges to the OEM bezel using the provided #6-32 long screws in the locations



8. Connect the Y harness to the back of the system in the locations shown below. On the top will be the buzzer (optional for audio feedback).

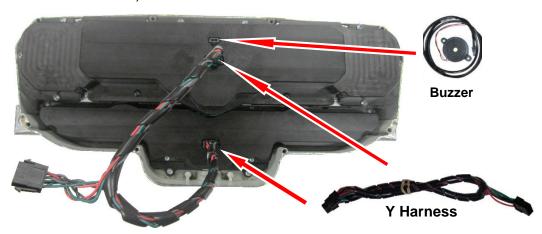

9. Connect the 36" main cable to the Y harness that is attached to the system. Connect the main cable and clock cable to mounted control box location

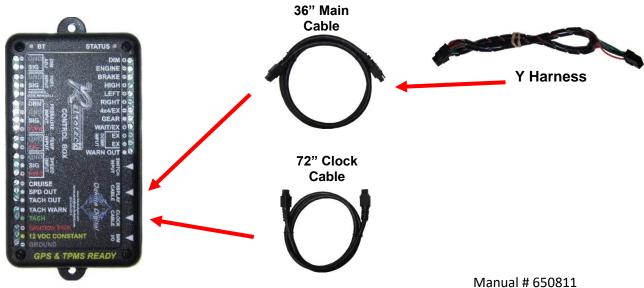

10. The cluster is now ready to re-install into the vehicle using the stock hardware from step #2.



11. Refer to the main manual and the clock manual for wiring instructions to complete the RTX installation.



▲WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to <a href="https://www.P65Warnings.ca.gov">www.P65Warnings.ca.gov</a>



4510 W. 61st St. North Sioux Falls, SD 57107

www.dakotadigital.com dakotasupport@dakotadigital.com Phone (605) 332-6513 Fax (605) 339-4106

© Copyright 2023 - Dakota Digital