




RTX-57F-PU

Dakota Digital RTX Instrument Installation
For 1957-'60 Ford Pickup

Your new **RTX-57F-PU** kit includes:

RTX Display

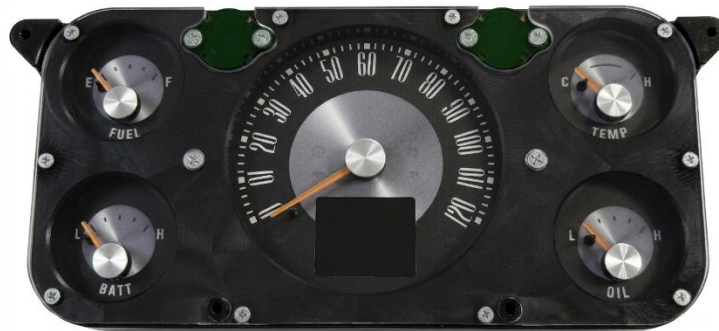

Universal Sender Pack



Buzzer




Installation Manuals



Switch Assembly



36" Main Harness

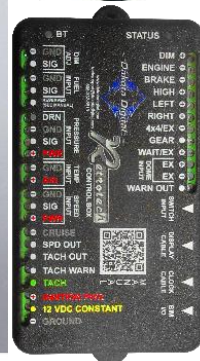

Control Box

2x Indicator Harness



Ford Speed Sender



Installation

1. Remove the stock gauge panel from the dash as well as the four screws holding the gauges in place. Retain all hardware for reassembly.




2. Secure the RTX system to the gauge panel using the four screws retained during disassembly.




3. This RTX system features two available turn signal configurations. Either new indicators hidden in the gauge face, or a second pair of indicators in the original locations may be used. To use the new integrated gauge-face indicators, please follow the wiring instructions for turn signals found in the main RTX manual.

If using the indicators in the original locations, do not wire the vehicle's turn signals to the RTX control box. Instead, use the two provided two-wire **Indicator Harnesses**. These harnesses plug directly into connectors on the back side of your new RTX system. Connect the wires from these harnesses to your turn signal circuit and ground as shown below. Doing this will light green LED bulbs, located in the original locations of your dash panel, when turn signals are active. Be sure to check left and right to verify they are wired to the correct corresponding circuit.

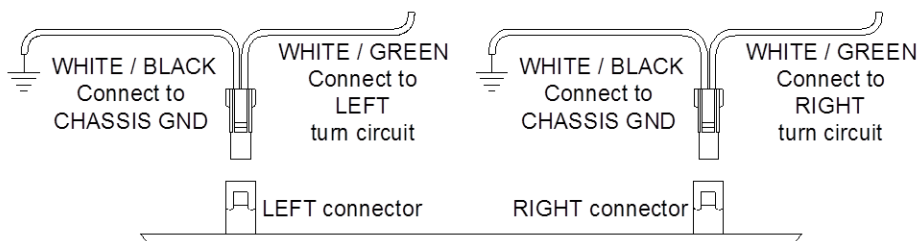

4. Connect the provided **36" Main Harness** and **Buzzer** (optional, for audio feedback) to the rear of the RTX system. Carefully route the open end of the main harness to the desired **Control Box** mounting location.

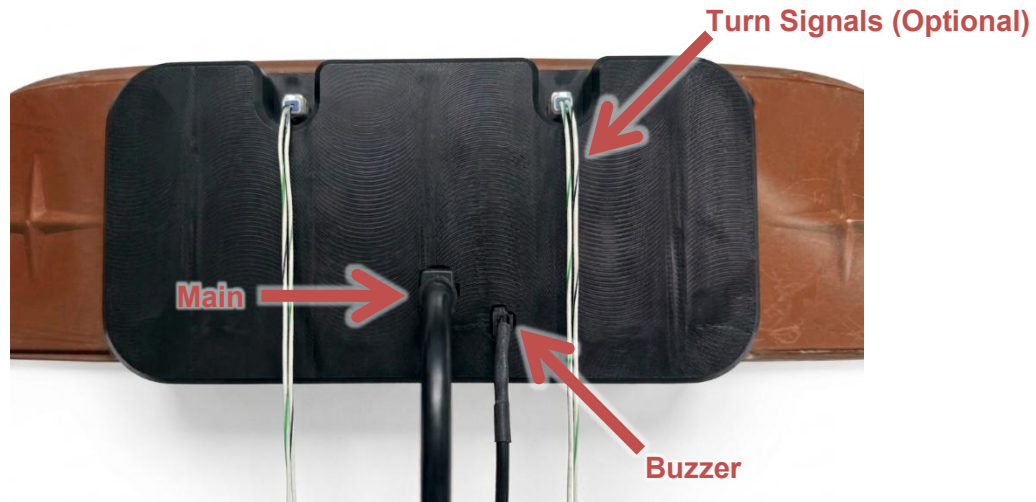

5. The dash panel and mounted RTX display is now ready to re-install into the vehicle using the original hardware. Refer to the main RTX manual to complete the system installation.



⚠ WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov



4510 W. 61st St. North
Sioux Falls, SD 57107
www.dakotadigital.com
dakotasupport@dakotadigital.com

Phone (605) 332-6513
Fax (605) 339-4106

© Copyright 2026 - Dakota Digital